

Shaft Alignment Report

Horizontal



Machine ID

Młyn egalizujący 250 kW

Date

20/02/2025, 08:51

Company

Serwis Silników Elektrycznych Wiktor Krzysztofek

Operator

Wiktor Krzysztofek

Notes

Tolerances

Speed (rpm)	Offset (mm)	Angular Error (mm/100)
0000-1000	0,13	0,10

Target Values

	Vertical	Horizontal
Offset (mm)	-	-
Angle (mm/100)	-	-

Stationary Unit (S):


TKSA 51, 1943-0102

Movable Unit (M):

TKSA 51, 1914-0185

Soft Foot Check Performed:



No

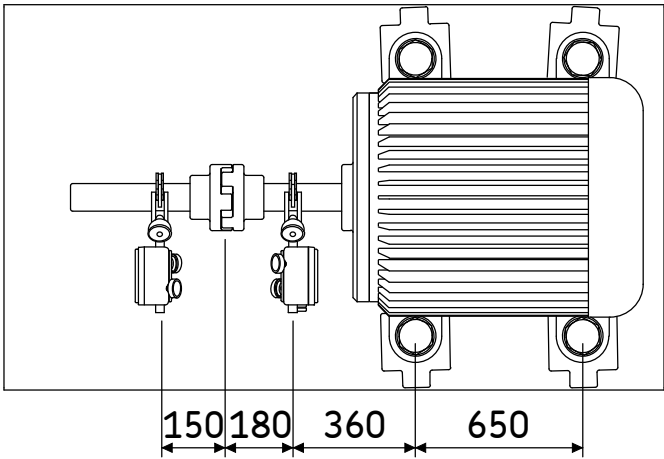

Result

As Found	Vertical	Horizontal
Offset (mm)	-0,81	0,19
Angle (mm/100)	-0,03	-0,69
Front Feet (mm)	-0,95	-3,55
Rear Feet (mm)	-1,13	-8,06

As Corrected	Vertical	Horizontal
Offset (mm)	-0,04	0,08
Angle (mm/100)	0,01	0,01
Front Feet (mm)	0,03	0,14
Rear Feet (mm)	0,11	0,22

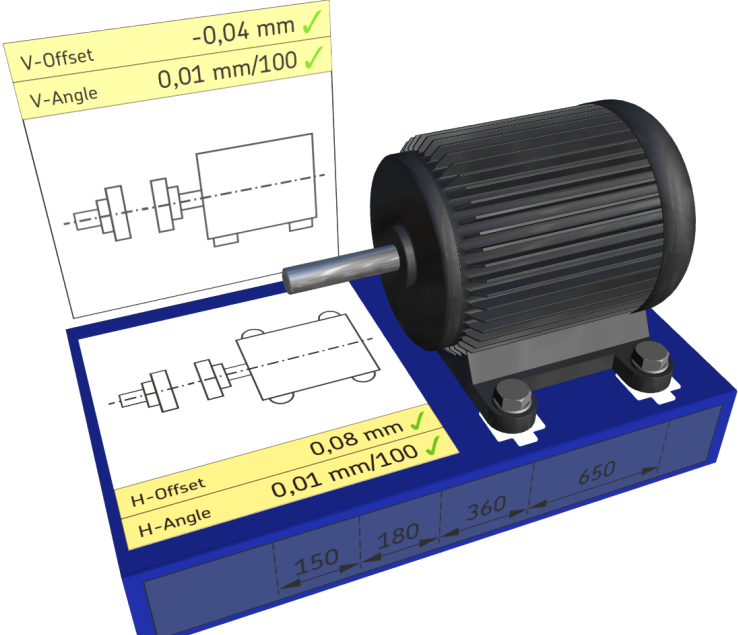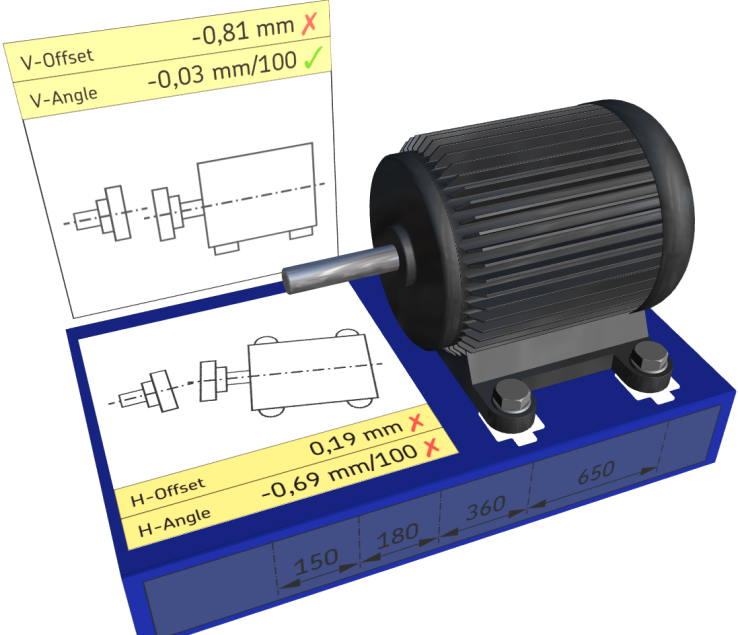

Signature

.....